

## QUOTATION

<b>Mode:</b> RT-1325BR	<b>Delivery term:</b> By sea	<b>Lead time:</b> 9-12 working days
<b>Price:</b> 6150 USD FOB Qingdao		
<b>Payment terms:</b>	T/T in advance	
<b>Package:</b> Standard wooden box	<b>Quality warranty:</b> 12 months	
<b>Net weight:</b> 1400KG	<b>Gross weight:</b> 1500KG	<b>Machine size:</b> 2200x3200x1700mm
<b>Packaging size:</b> 2300x3300x1800mm		
<b>Technical details:</b>		
<b>X,Y,Z Working Area</b>	1300x2500x200mm	
<b>Rotary axis</b>	200mm diameter, 2500mm length	
<b>X,Y,Z Traveling Positioning Accuracy</b>	±0.02/300mm	
<b>X,Y,Z Reposition Accuracy</b>	±0.03mm	
<b>Lathe Structure</b>	Steel pipe welded Structure	
<b>X, Y Structure</b>	Taiwan Hiwin square rail and bearings; Helical rack pinion	
<b>Z Structure</b>	Taiwan Hiwin square rail and bearings; TBI ball screw	
<b>Max. Consume power</b>	6.0Kw	
<b>Max.Speed</b>	0-50000mm/min	
<b>Max. Working Speed</b>	0-30000mm/min	
<b>Spindle Power Motor</b>	3.0kw water-cooling spindle	
<b>Spindle Speed</b>	0-24000RPM	
<b>Working Mode</b>	Stepper	
<b>Working Voltage</b>	AC380V 3 phase	
<b>Command</b>	G Code, *uoo, *mmg, *plt	

### Main Parts Configuration and Pictures:

- #Steel welding machine body
- #1300\*2500\*200mm XYZ working size
- #4<sup>th</sup> rotary axis size 200x2500mm, double chucks
- #Vacuum table with T-slot, 5.5KW water cooling vacuum pump
- #3.0 KW water cooled spindle, 0-24000RPM
- #Fuling inverter
- #86BYG stepper motor and Leadshine driver
- #X Y axis Taiwan Hiwin square rail and bearings; Helical rack pinion
- # Z axis Taiwan Hiwin square rail and bearings; TBI ball screw
- #Mach3 4 axis computer control system, USB interface
- #Oil lubrication
- #Auto Z zero tool probe
- #Dust collector



3.0 kw Water Cooling Spindle




Fuling Inverter



5.5KW vacuum pump



Stepper Motor and Driver

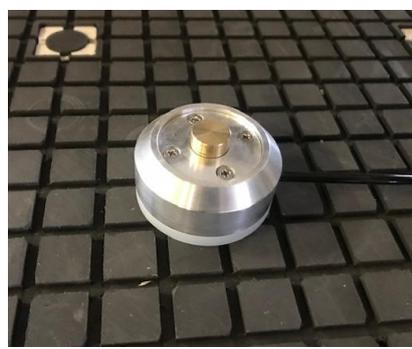

Auto Z zero tool probe



Dust collector



Independent control box




Helical rack and pinion



Oil lubrication



Schneider electronics

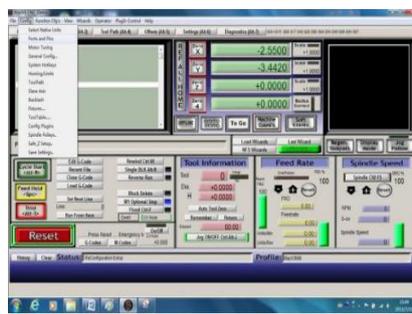

Mach3 4 axis control system




Advanced Mach3 USB motion board

## Accessories List:

Signal cable	1
User manual	1
Spindle spanner	2
Tools collets	2
Tool	12
Spare belt	2
Kit box	2
Water pump for spindle cooling	1
Clamping device	6

## Machine Pictures:



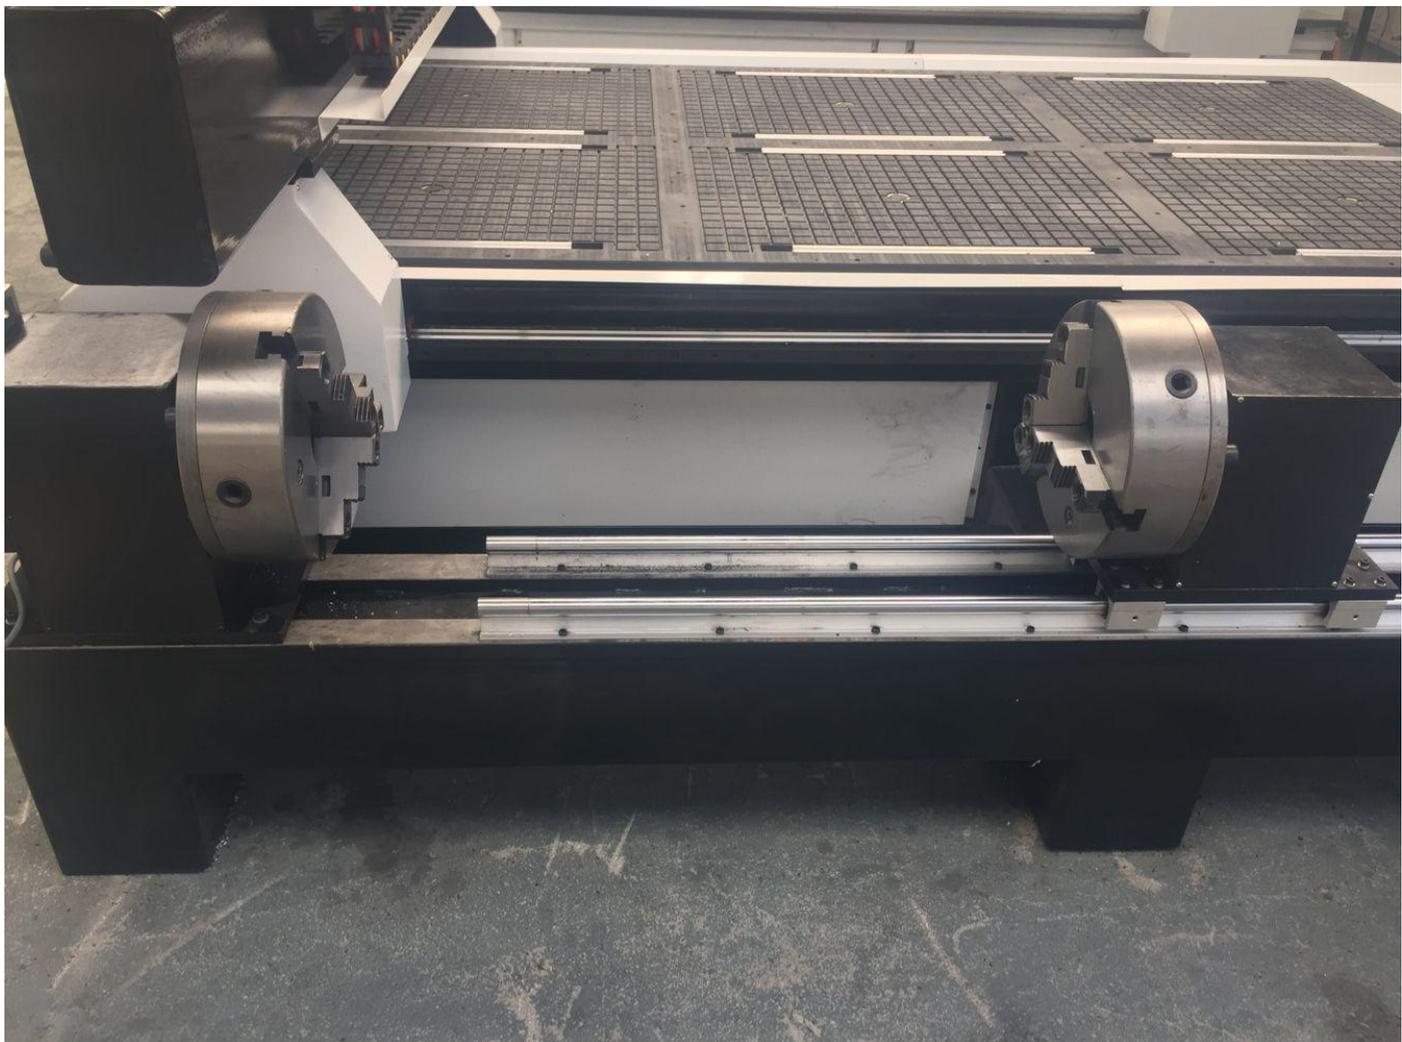



**Package:**



**Samples:**





### Optional Function



**Mach3 MPG Hand Wheel +\$100**



**5.5KW +\$400**



**Servo motor and servo driver +\$700**

**Address:** Qiuja Street, Yangjia Zhuang North Village, Baiyunhu Town, Zhangqiu

**Contact:** Mac Grady

**Email:** mac@robotecnc.com / rodeomac@cncncmachine.com

**Skype:** cncmac01

**Viver/Whatsapp:** 008615688411463

**Wechat/QQ:** 676338662